

RCSL: 44 - RT 1911

MANDATORY	<input type="checkbox"/>	RETROFIT ON FAILURE	<input checked="" type="checkbox"/>
WARRANTY	<input checked="" type="checkbox"/>	NON WARRANTY	<input type="checkbox"/>

PAGE	1	OF	1
RE: ECN NO:			

SERIAL EFFECTIVITY MIC 703, S/N 1534	EQUIPMENT AFFECTED RC700 RC702/DSP 701 Data Separator Print
---	--

NOTE
This FCO is irrelevant if FCO 19-008 is not implemented

REASON FOR CHANGE

The IC SN74LS153 may not be fast enough in maxi floppy disc applications. In this case the computer may not read the floppy.

DESCRIPTION OF CHANGE

- Change the SN74LS153 to a SN74S153
- Code the FCO label: 19-011

ADDITIONAL COMMENTS

THE FCO-KIT CAN BE ORDERED AT THE SPARE PART STOCK UNDER RC-PARTNUMBER: 8-0911
ADDRESS: HOVEDVEJEN 9, DK-2600 GLOSTRUP DENMARK

KITS FREE OF CHARGE YES NO

THE FCO-KIT INCLUDES:

QTY	DESCRIPTION	RC P/N
1	SN74S153	125026

DOCUMENTATION ENCLOSED

None

ESTIMATED INSTALLATION TIME: 0,5 h

PROJECT ENGINEER SIGN. <i>H.P. Pedersen</i>	DATE <i>26/4 82</i>	DEVELOPMENT MANAGER SIGN. <i>[Signature]</i>	DATE <i>29/4 82</i>	SYN. PRODUCTION MANAGER SIGN. <i>[Signature]</i>	DATE <i>29/4 82</i>	TECH. SERVICE MANAGER SIGN. <i>[Signature]</i>	DATE <i>28/4 82</i>
--	---------------------	---	---------------------	---	---------------------	---	---------------------