

RCSL: 44 - RT 1911

MANDATORY	<input type="checkbox"/>	RETROFIT ON FAILURE	<input checked="" type="checkbox"/>
WARRANTY	<input checked="" type="checkbox"/>	NON WARRANTY	<input type="checkbox"/>

PAGE	1	OF	2
RE: ECN NO:			

<b>SERIAL EFFECTIVITY</b> All keyboards produced after september th 1st 1981	<b>EQUIPMENT AFFECTED</b> <u>Key-tronic keyboards</u> RC721, RC722, RC801, RC802, RC803, RC805 keyboards.
<b>NOTE</b>	

**REASON FOR CHANGE**

The sockets for the CPU, the program ROM and the external ASCII ROM has too low contact pressure and too poor contact surface.  
The keyboard may fail after an interval of 1 to 12 months. The manufacturer of the sockets is "SCANBE",

The error sympton is keyboard in deadlock, normally with "LOCK" led lit

**DESCRIPTION OF CHANGE**

1. Change the 3 sockets to those supplied with the FCO-Kit. See next page.
2. Change the program PROM to a KTC-013. The old PROM must be returned.
3. Code the FCO-label: 19-006.

**ADDITIONAL COMMENTS**

The eprom must be returned for reprogramming

THE FCO-KIT CAN BE ORDERED AT THE SPARE PART STOCK  
UNDER RC-PARTNUMBER: 8-0906  
ADDRESS: HOVEDVEJEN 9, DK-2600 GLOSTRUP DENMARK

KITS FREE OF CHARGE	YES <input checked="" type="checkbox"/>	NO <input type="checkbox"/>
---------------------	---	-----------------------------

THE FCO-KIT INCLUDES:

QTY	DESCRIPTION	RC P/N
1	40 pin socket	4-9818
2	24 pin socket	6-0005
1	2716 EPROM type KTC-013	


**DOCUMENTATION ENCLOSED**

ESTIMATED INSTALLATION TIME: 0,5 h

PROJECT ENGINEER	DEVELOPMENT MANAGER	SYS. PRODUCTION MANAGER	TECH. SERVICE MANAGER
SIGN.	SIGN.	SIGN.	SIGN.
<i>M. Pedersen</i>	<i>[Signature]</i>	<i>[Signature]</i>	<i>[Signature]</i>
DATE: <i>2/8 81</i>	DATE: <i>2/8 81</i>	DATE: <i>19-81</i>	DATE: <i>19-81</i>



# FIELD CHANGE ORDER

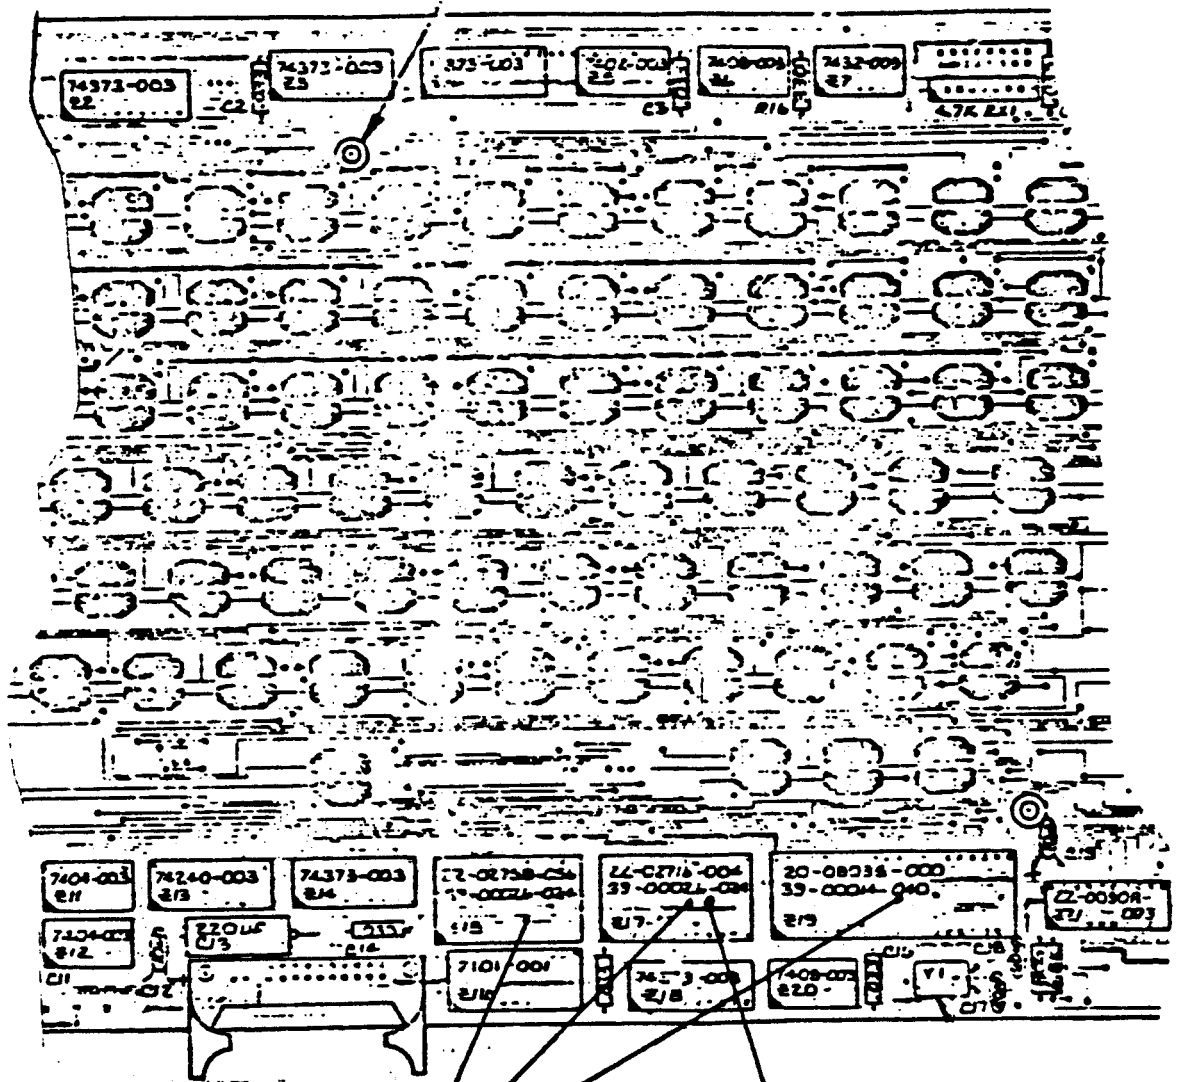

Insert 3 new sockets

Change EPROM to new version: KTC 013

Modification to  
RC 721 / RC 722 Keyboard  
and RC 850