

RCSL: 44 - RT 1911

MANDATORY	<input type="checkbox"/>	RETROFIT ON FAILURE	<input checked="" type="checkbox"/>
WARRANTY	<input type="checkbox"/>	NON WARRANTY	<input checked="" type="checkbox"/>

PAGE	1	OF	2
RE: ECN NO:	19-004		

SERIAL EFFECTIVITY MIC 703/1001 and upwards	EQUIPMENT AFFECTED RC 700 RC 702 / MIC 702 and MIC 703 Microprocessor.
NOTE	

REASON FOR CHANGE

The MEM CLOCK oscillator has caused problems in the production, which has been solved by changing the transistor or the Xtal. In case of such problem change of two capacitors is the correct solution.

DESCRIPTION OF CHANGE

- Change C 3 from 4.7 pF to 33 pF. (see page 2)
- Change C 1 from 68 pF to 330 pF. (see page 2)
- Code the FCO-label: 19-004.

ADDITIONAL COMMENTS

THE FCO-KIT CAN BE ORDERED AT THE SPARE PART STOCK UNDER RC-PARTNUMBER:
ADDRESS: HOVEDVEJEN 9, DK-2600 GLOSTRUP DENMARK

KITS FREE OF CHARGE YES NO

THE FCO-KIT INCLUDES:

QTY	DESCRIPTION	RC P/N
1	Capacitor 33pF	0802018
1	Capacitor 330pF	08102033

DOCUMENTATION ENCLOSED

None

ESTIMATED INSTALLATION TIME: 1.0 hour.

PROJECT ENGINEER SIGN. <i>M. C. Pedersen</i>	DATE 3/14 81	DEVELOPMENT MANAGER SIGN. <i>[Signature]</i>	DATE 1/581	SYS. PRODUCTION MANAGER SIGN. <i>[Signature]</i>	DATE 1/581	TECH. SERVICE MANAGER SIGN. <i>[Signature]</i>	DATE 1/581
---	-----------------	---	---------------	---	---------------	---	---------------



FIELD CHANGE ORDER

NO. 19-004

PAGE 2 OF 2

