

COMPUTER

A/S REGNECENTRALEN af 1979

FIELD CHANGE ORDER

NO: 19-010
ISSUE WEEK 82-15

RCSL: 44 - RT 1911

MANDATORY	<input type="checkbox"/>	RETROFIT ON FAILURE	<input checked="" type="checkbox"/>
WARRANTY	<input checked="" type="checkbox"/>	NON WARRANTY	<input type="checkbox"/>

PAGE	1	OF	1
RE: ECN NO:			

SERIAL EFFECTIVITY RCM 703, S/N 813	EQUIPMENT AFFECTED RC700 RC702/POW 739 Power Supply
--	--

NOTE

REASON FOR CHANGE

The connection from 0 V on the power regulator board to the chassis can be inadequate. This may cause "bad blocks" status from the floppy disc.

DESCRIPTION OF CHANGE

The fixing screw close to plug P1 in the power supply serves as a earthing point. To ensure connection the chassis, paint must be stripped around the fixing screw hole, then a tooth-washer is placed between the PCB and chassis.

ADDITIONAL COMMENTS

THE FCO-KIT CAN BE ORDERED AT THE SPARE PART STOCK UNDER RC-PARTNUMBER: 8-0910
ADDRESS: HOVEDVEJEN 9, DK-2600 GLOSTRUP DENMARK

KITS FREE OF CHARGE YES NO

THE FCO-KIT INCLUDES:

QTY	DESCRIPTION	RC P/N
1	Tooth-washer 28202001	

DOCUMENTATION ENCLOSED

1 drawing

ESTIMATED INSTALLATION TIME: 0,5 h

PROJECT ENGINEER		DEVELOPMENT MANAGER		SYN. PRODUCTION MANAGER		TECH. SERVICE MANAGER	
SIGN.	DATE	SIGN.	DATE	SIGN.	DATE	SIGN.	DATE
MUP	27/4 82	<i>[Signature]</i>	28/4 82	<i>[Signature]</i>	29/4 82	<i>[Signature]</i>	28/4 82

